

Vakuu Chamber Machine 07P

Malfunctions	Cause	Remedy
Machine does not appear on the display after turning on the main switch.	El. Supply not ensured. Mains automatic circuit breaker triggered. Fine wire fuse burnt through.	Check El. connections. Switch on mains automatic circuit breaker. Replace fine wire fuse 16 AT.
Main switch does not remain in the On position	Main switch defective. Fine wire fuse burnt through. Interruption in 48 VAC supply. Excess temperature switch at the sealing transformer has been triggered. Voltage setting at the transformer incorrect.	Check main switch and possibly replace. Replace fine wire fuse 2 AT. Call the VC999 Customer Service Dept. Allow sealing transformer to cool off. Call the VC999 Customer Service Dept.
Keyboard and display do not react	Malfunction of the microprocessor by power supply. Defective microprocessor.	Turn off main switch and after ca. 10 seconds switch on again. Possibly repeat again. Call the VC999 Customer Service Dept.
Platform does not move products out.	Transport time in the packaging program set to "0" Transport type in service program on "OFF"	Set transport time in accordance with "Transport time". Set mode of transport in the service program to "ON".
Program cannot be altered anymore	Programs locked.	Set number of locked programs to "0", see Chapter 10.6.12 "Number of locked programs"
Program cannot be selected.	Key switch closed.	Open key switch
Malfunctioning seal	Sealing time not properly set Teflon tape on sealing bar damaged Power contact springs on sealing bar make no contact Pressure too low	Set sealing time Replace Teflon Chapter Clean power contact springs Call the VC999 Customer Service Dept.
Vacuumping too weak	The partner machine is vacuuming with evaporation Condensate in measuring system	Switch off VVO extension Call the VC999 Customer Service Dept
Ruined products	Bag material unsuitable Cooling chain was interrupted	Use suitable bag material Dispose packaging properly
Partner machine not ready.	Main switch not turned on Machine not in initial position or in sleep mode Error in the wiring of the interconnection	Turn on main switch Call the VC999 Customer Service Dept..